

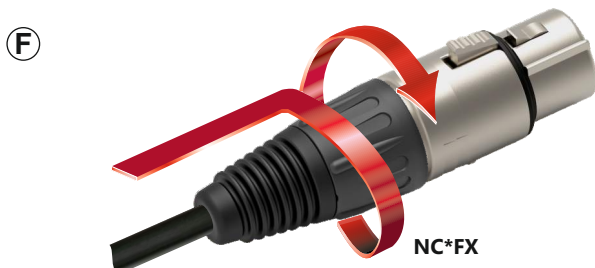
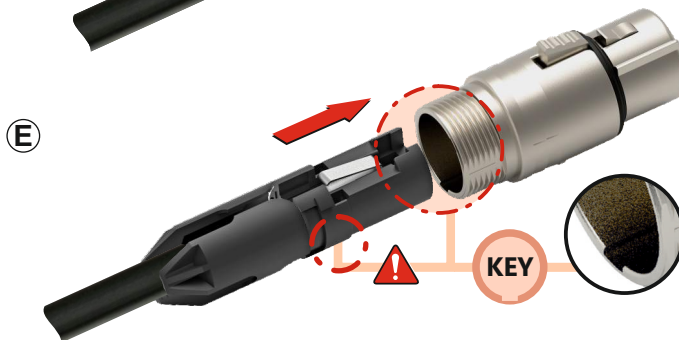
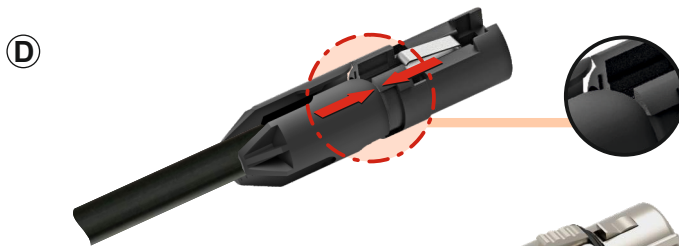


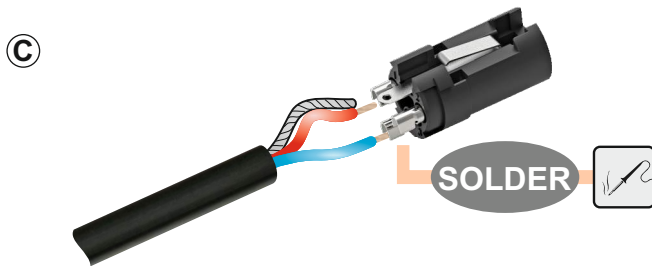

ASSEMBLY INSTRUCTION

NC*FX | Female XLR Cable Connector

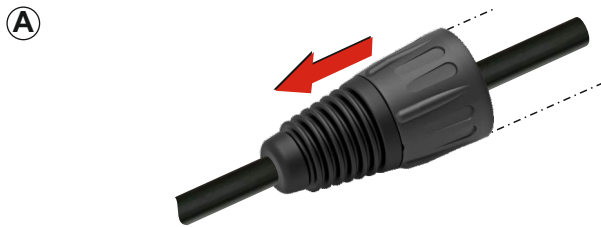

A Slide the boot onto the cable.

B Prepare cable as shown.
Cable O.D. 3.5 - 8.0 mm [0.14 - 0.32"]
Wiresize max. 2.5 mm² / AWG 14

C Insert wires into the terminals and solder them.

D Put chuck onto the cable.


Attention:
Pay attention to the exact position as shown in the picture.

E Slide insert and chuck together into the housing.

Attention:
Pay attention to the position of the key.

F Finish the installation by turning the bushing onto the connector.

SCOPE OF DELIVERY

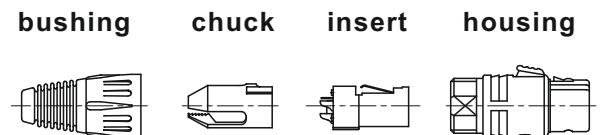

XLR Connectors:
Find more details on
www.neutrik.com



*: 3 - 7 contacts

Neutrik AG LI T: +423 / 237 24 24 F: +423/232 53 93
Neutrik USA Inc. USA T: +1 704 / 972 3050 F: +1 704/438 9202
Neutrik (UK) Ltd. UK T: +44 1983 / 811 441 F: +44 1983/811 439
Neutrik Vertriebs GmbH DE/NL/AT/DK T: +49 8131 / 280 890 F: +49 8131/280 830

Neutrik France FR T: +33 1/4131 6750 F: +33 1/4131 0511
Neutrik Tokyo Ltd. JP T: +81 3/3663 4733 F: +81 3/3663 4796
Neutrik Hong Kong Ltd. HK T: +852/2687 6055 F: +852/2687 6052
Neutrik India Pvt. Ltd. IND T: +91/982 05 43 424 F: +91/22 26163 540

Draft. Nr.: BDA 609 | Update: 2020-07-02 | Data subject to change without prior notice. © 2020 NEUTRIK®. NEUTRIK® are registered trademark of Neutrik AG. ALL RIGHTS RESERVED.

www.neutrik.com

NEUTRIK